Cat. No. Z144-E1-1

F160 Vision Sensor

Manual 1: SETUP MANUAL

OMRON

F160 Vision Sensor

Manual 1: Setup Manual

Notice:

OMRON products are manufactured for use according to proper procedures by a qualified operator and only for the purposes described in this manual.

The following conventions are used to indicate and classify precautions in this manual. Always heed the information provided with them. Failure to heed precautions can result in injury to people or damage to property.

- **DANGER** Indicates an imminently hazardous situation which, if not avoided, will result in death or serious injury.
- WARNING Indicates a potentially hazardous situation which, if not avoided, could result in death or serious injury.
- **Caution** Indicates a potentially hazardous situation which, if not avoided, may result in minor or moderate injury, or property damage.

OMRON Product References

All OMRON products are capitalized in this manual. The word "Unit" is also capitalized when it refers to an OMRON product, regardless of whether or not it appears in the proper name of the product.

Visual Aids

The following headings appear in the left column of the manual to help you locate different types of information.

- **Note** Indicates information of particular interest for efficient and convenient operation of the product.
- 1,2,3... 1. Indicates lists of one sort or another, such as procedures, checklists, etc.
- **Precaution** Indicates information required to take full advantage of the functions and performance of the product. Incorrect application methods may result in the loss of damage or damage to the product. Read and follow all precautionary information.
 - **CHECK** Indicates points that are important in using product functions or in application procedures.
- TwoCamera Indicates information required when using a 2-camera system.
 - **SeeAlso** Indicates where to find related information.
 - **HELP** Indicates information helpful in operation, such as the definition of terms.

© OMRON, 2001

All rights reserved. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form, or by any means, mechanical, electronic, photocopying, recording, or otherwise, without the prior written permission of OMRON.

No patent liability is assumed with respect to the use of the information contained herein. Moreover, because OMRON is constantly striving to improve its high-quality products, the information contained in this manual is subject to change without notice. Every precaution has been taken in the preparation of this manual. Nevertheless, OMRON assumes no responsibility for errors or omissions. Neither is any liability assumed for damages resulting from the use of the information contained in this publication.

TABLE OF CONTENTS

PRECA	UTIONS xi
1	General Safety Precautions xii
2	Special or Critical Applicationsxiii
3	Regulations and Standardsxiv
SECTIO	DN 1
Introdu	ction1
1-1	Installation Precautions 2
1-2	Confirming Package Contents 5
1-3	Product Availability
SECTIO	DN 2
Installat	ion and Connections7
2-1	Basic System Configuration
2-2	Component Names and Functions 10
2-3	Mounting the Controller 11
2-4	Connecting Peripheral Devices 15
2-5	Overview of Available Cameras
2-6	Power Supply and Ground
	Lighting, and Memory Cards
3-1	CCTV Lenses
3-2	Lighting
3-3	Memory Cards
SECTIC Connect	ON 4cing External Devices
4-1	Connecting through the Parallel Interface
4-2	Connecting through the Serial Interface
SECTIO	ON 5 shooting and Maintenance
5-1	Troubleshooting
5-2	Maintenance
5-3	Regular Inspections
5-4	Specifications
5-5	F200/F300 Camera Parameters
5-6	Connecting a Strobe Device
Index	
Revisior	• History

About this Manual:

This manual describes the hardware for the F160 Vision Sensor and how to install the components, and it includes the sections described below. This is one of four manuals used to operate the F160. Refer to the following table for the contents of each manual.

Manual	Contents	Cat. No.
1: Setup Manual	Provides information on system hardware and installa- tion. Be sure to read this manual first.	Z144-E1-1
2: Conversational Menu Operation Manual	Describes operation of the F160 using the Conversa- tional Menus. The Conversational Menus enable the simplest operation based on registered images of acceptable and unacceptable products.	Z145-E1-1
3: Expert Menu Operation Manual	Describes operation of the F160 using the Expert Menus. The Expert Menu enable application of all F160 capabili- ties, including setting region images and criteria.	Z147-E1-1
4: Communications Reference Man- ual	Describes the communications settings and communica- tions protocol used to transfer data through the parallel interface or serial interface.	Z146-E1-1

Please read the above manuals carefully and be sure you understand the information provided before attempting to install or operate the F160.

Section 1 *Introduction* describes the precautions that must be taken when installing and operating the F160 Vision Sensor.

Section 2 *Installation and Connections* shows a basic F160 system configuration and explains how to install the F160 and connect it to a power supply and peripheral devices.

Section 3 Lenses, Lighting, and Memory Cards describes how to select and use these components most effectively.

Section 4 Connecting External Devices describes how to connect external devices through a parallel interface (the I/O terminals or I/O connector) or serial interface (the RS-232C/RS-422 connector).

Section 5 *Troubleshooting and Maintenance* provides tables to help identify and correct hardware errors that may occur with the F160 as well as information on maintenance and periodic inspections.

WARNING Failure to read and understand the information provided in this manual may result in personal injury or death, damage to the product, or product failure. Please read each section in its entirety and be sure you understand the information provided in the section and related sections before attempting any of the procedures or operations given.

PRECAUTIONS

This section provides general precautions for using the F160 Vision Sensor.

The information contained in this section is important for the safe and reliable application of the F160 Vision Sensor. You must read this section and understand the information contained before attempting to set up or operate an F160 Vision Sensor.

1	General Safety Precautions	xii
2	Special or Critical Applications	xiii
3	Regulations and Standards	xiv


1 General Safety Precautions

Battery Precautions

- WARNING Do not disassemble the F160, apply pressure to the F160 that would deform its shape, or incinerate the F160. A lithium battery is built into the F160 and it may combust, explode, or burn if not treated properly.
- WARNING Do not short circuit, attempt to charge, disassemble, apply pressure that would deform, or incinerate the lithium battery. The lithium battery may start a fire, explode, or burn if not treated properly.

Installation Environment Precautions

- **Caution** Do not use the F160 in environments with flammable or explosive gases.
- **Caution** Install the F160 away from high-voltage devices and moving machinery to allow safe access during operation and maintenance.
- **Caution** Do not block the F160's cooling vents.

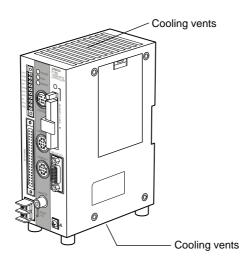

Before the F160 is shipped, a protective label is attached to the top of the F160 to cover the cooling vents. This label prevents wire strands from falling into the F160 during wiring, so it must not be removed until wiring is completed. The label must be removed after wiring to allow proper cooling during operation.

 \triangle **Caution** Be sure to securely tighten the screws when mounting the F160.

Power Supply and Wiring Precautions

- / Caution Use the F160 with the power supply voltages specified in this manual.
- Caution Use the wire and crimp terminals of the proper sizes as specified in this manual. Do not connect the power supply wires by just twisting stranded wire and connecting directly to the terminals.
- Caution Use a DC power supply with countermeasures against high-voltage spikes (safe extra low-voltage circuits on the secondary side).

Note	1.	Keep the power supply wires as short as possible.
	2.	Ground the F160's ground terminal to less than 100 Ω .
	3.	Use a grounding point as close as possible to the F160 and keep the ground line as short as possible.
	4.	Wire the F160 to the ground with a separate ground wire. To avoid ground- ing problems, do not share the ground wiring with any other devices or ground the F160 to the building's steel framing/plumbing.

Other Precautions

Caution Do not attempt to dismantle, repair, or modify the F160.

- **Caution** Do not touch fluorescent or halogen lights while the power is ON or immediately after the power is turned OFF. These lights get very hot and can cause burns.
- Caution If you suspect an error or malfunction, stop using the F160 immediately, turn OFF the power supply, and consult your OMRON representative.

Note Dispose of the F160 as industrial waste.

2 Special or Critical Applications

When the F160 will be used in one of the conditions or applications listed below, allow extra safety margins in ratings and functions, add extra safety features such as fail-safe systems, and consult your OMRON representative.

- Operating conditions or environments which are not described in the manual
- Nuclear power control systems, railroad systems, aviation systems, vehicles, combustion systems, medical equipment, amusement equipment, or safety equipment
- Other systems, machines, and equipment that may have a serious influence on lives and property and require extra safety features

3 Regulations and Standards

The F160 complies with the international regulations and standards below.

- 1. EU Regulations EMC Directive: No. 89/336/EEC
- EN Standards (European Standards) EN 61000-6-2: 1999, EN 61326: 1997/Annex A+A1: 1998, EN 50081-2: 1997/Class A

SECTION 1 Introduction

This section describes the precautions that must be taken when installing and operating the F160 Vision Sensor.

1-1	Installa	tion Precautions	2
	1-1-1	Controller Installation	2
	1-1-2	Component Installation and Handling	3
1-2	Confirm	ning Package Contents	5
1-3	Product	Availability	6

1-1 Installation Precautions

The F160 is highly reliable and resistant to most environmental factors. The following guidelines, however, must be followed to ensure reliability and optimum use of the F160.

Caution Read the *Precautions* section before proceeding with installation or operation.

1-1-1 Controller Installation


Installation Site

Do not install the F160 in locations subject to the following conditions:


- 1,2,3... 1. Ambient temperatures outside of the 0 to 50°C (32 to 122°F) range
 - 2. Rapid temperature fluctuations (likely to cause condensation)
 - 3. Relative humidities outside of the 35% to 85% range
 - 4. Presence of corrosive or flammable gases
 - 5. Presence of dust, salt, or iron particles
 - 6. Direct vibration or shock
 - 7. Direct sunlight
 - 8. Water, oil, or chemical fumes or spray

Orientation of Controller

To improve heat dissipation, install the Controller in the following orientation only:

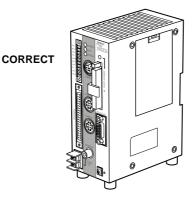


Do not install the Controller in the orientations shown in the following diagram. **INCORRECT**

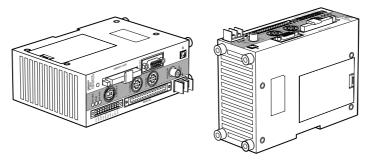

Ambient Temperature

- **1,2,3...** 1. Maintain a minimum clearance of 50 mm above and below the F160 to improve air circulation.
 - 2. Do not install the F160 immediately above significant heat sources, such as heaters, transformers, or large-capacity resistors.
 - 3. Do not let the ambient operating temperature exceed 50°C (122°F).
 - Provide a forced-air fan cooling or air conditioning if the ambient temperature is near 50°C (122°F) so that the ambient temperature never exceeds 50°C (122°F).

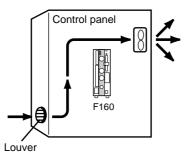


Noise Resistance

Use the following measures to help increase noise resistance.

1,2,3... 1. Do not install the F160 in a cabinet containing high-voltage equipment.

 2. Do not install the F160 within 200 mm of power cables.



1-1-2 Component Installation and Handling

OMRON Components

Use a Camera, Camera Cable, and Console designed specifically for the F160.

Connecting Cables

Always turn OFF the F160's power before connecting or disconnecting a camera or cable.

Handling the Camera

The Camera's case is connected to the 0V line in the internal circuits. Observe the following precautions to prevent noise interference.

- 1,2,3... 1. Do not ground the Camera.
 - 2. Do not remove the base attached to the Camera.
 - 3. Do not remove the core attached to the F150-VS Camera Cable.

Securing the Video Monitor (When Using the Recommended F150-M09)

Observe the following precautions to prevent noise interference, because the video monitor case is connected to the 0V line in the internal circuits.

- 1,2,3... 1. Do not ground the video monitor.
 - 2. Do not ground the metallic part of the connector.
 - 3. Secure the video monitor with plastic screws if it is being mounted to a metallic surface.

Touching Signal Lines

To prevent damage from static electricity, use a wrist strap or another device for preventing electrostatic discharges when touching terminals or signal lines in connectors.

Removing the Memory Card

Before removing a Memory Card, stop the power supply to the Card or turn OFF the F160. The Memory Card or the F160 itself may be damaged if a Memory Card is removed while power is being supplied.

(Stop the power supply to the Memory Card from the menu.)

Turning OFF the Power

Do not turn OFF the power while a message is being displayed indicating that processing is being performed. Data in memory will be corrupted, and the F160 may not operate correctly the next time it is started.

0.Scn 0 ▼ MON ▼	 ms
Saving data.	

 
Using the RESET Signal

Do not use the RESET input immediately after power is turned ON. When using the RESET input to synchronize startup timing, wait at least 1 second after the F160's power supply is turned ON before turning ON the RESET signal.


1-2 Confirming Package Contents

Check the contents of the package as soon as you receive the F160. It is extremely rare for components to be missing, but contact the nearest OMRON representative if any of the following items are missing.


1,2,3... 1. F160 Vision Mate Controller Qty.: 1



2. Mounting Bracket (for rear surface mounting)

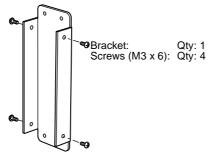

 3. Connector for I/O Terminals Qty.: 1 (Phoenix Contact model MC1.5/10-STF-3.5)



4. Ferrite Core for F150-VM Monitor Cable Qty.: 1



- 5. Setup Manual (this manual) Qty.: 1
- 6. Conversational Menu Operation Manual Qty.: 1
- 7. Expert Menu Operation Manual Qty.: 1
- 8. Communications Reference Qty.: 1

1-3 Product Availability

Some of the products listed may not be available in some countries. Please contact your nearest OMRON sales office by referring to the addresses provided at the back of this manual.

SECTION 2 Installation and Connections


This section shows a basic F160 system configuration and explains how to install and wire the F160.


2-1	Basic S	ystem Configuration	8
2-2	Compo	nent Names and Functions	10
2-3	Mounti	ng the Controller	11
	2-3-1	DIN Track Mounting	11
	2-3-2	Rear Surface-mounting	12
	2-3-3	Side Surface-mounting	14
	2-3-4	Bottom Surface-mounting	15
2-4	Connec	ting Peripheral Devices	15
	2-4-1	Connecting a Console	16
	2-4-2	Connecting a Monitor	16
	2-4-3	Connecting a Camera	16
2-5	Overvie	ew of Available Cameras	16
2-6	Power S	Supply and Ground	18
	2-6-1	Crimp Terminals and Cables	18
	2-6-2	Ground (Earth) Wiring	18
	2-6-3	Wiring the Power Supply	19

2-1 Basic System Configuration

Precaution

The following diagram shows the basic F160 system configuration. Some of the components shown in the configuration diagram are special OMRON products that cannot be substituted with comparable devices. These items are indicated with an asterisk.

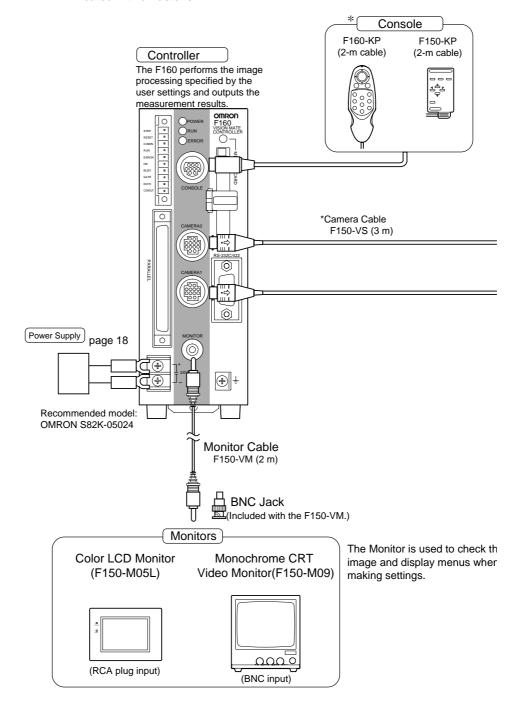

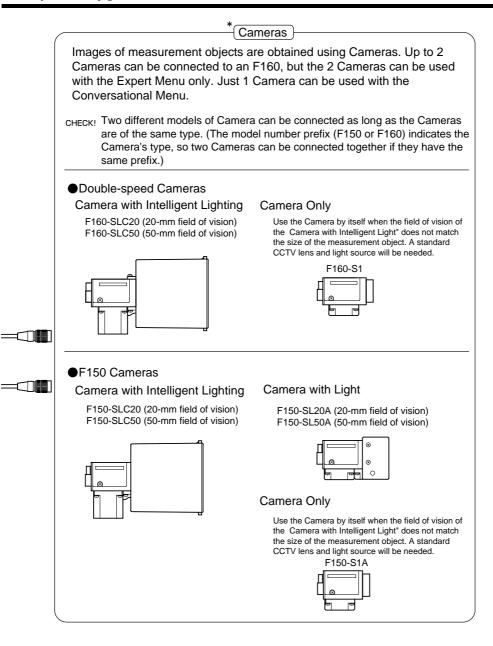

CHECK

F200-series and F300-series Cameras can also be connected.


Camera type	Camera Cable	Max. number of Cameras
F200-S	F160-VSR3	1 (Connect to camera connector 0.)
F300-S	F160-VSR4	2
F300-S2R	F160-VSR3	(The 2 cameras must have the same model number.
F300-S3DR		Only one camera can be connected with the Conversational Menu.)
F300-S4R		

SeeAlso

Refer to page 63 for details on parameter settings.

2-2 Component Names and Functions

The following diagram shows the F160 Vision Mate Controller's major external components.

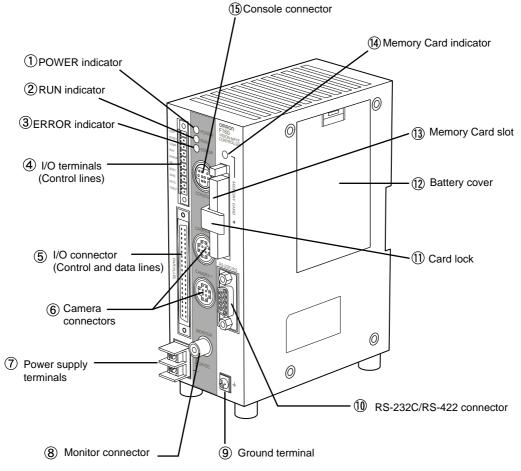

- 1. Lit while power is ON.
- 2. Lit while the F160 is in Run Mode.
- 3. Lit when an error has occurred.
- 4. Connects the F160 to external devices such as a sync sensor or PLC.
- 5. Connects the F160 to external devices such as a sync sensor or PLC.
- 6. Connects to the Camera(s).
- 7. Connects to the power supply.
- 8. Connects to the monitor.
- 9. Connects to the ground wire.
- 10. Connects the F160 to an external device such as a personal computer or PLC.
- 11. This lock secures the Memory Card so that it does not disconnect unintentionally from vibration.
- 12. Covers the compartment that contains the F160's battery.
- 13. This slot receives the Memory Card.


- 14. Lit when power is being supplied to the Memory Card. (The Memory Card must not be inserted or removed when this indicator is lit.)
- 15. Connects the F160 to a Console.

2-3 Mounting the Controller

There are four ways to mount the Vision Mate Controller: DIN Track mounting, rear surface-mounting, side surface-mounting, or bottom surface-mounting.

2-3-1 DIN Track Mounting

The Vision Mate Controller can be easily mounted to or removed from 35-mm DIN Track.

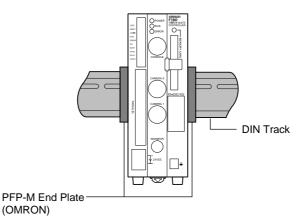

The following DIN Tracks are available from OMRON.


Model	Length
PFP-100N	1 m
PFP-50N	50 cm
PFP-100N2	1 m

Mounting the Controller

Hook the Controller into the DIN Track as shown in the diagram and then press in at the bottom until the Controller locks into place.


Removing the Controller

Use a screwdriver to pull the hook down and then pull out the Controller from the bottom.

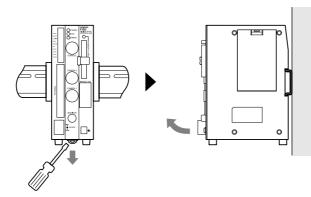



2-3-2 Rear Surface-mounting


1. Attach the mounting bracket to the F160 Controller using the four machine screws (M3 \times 6) included with the bracket.

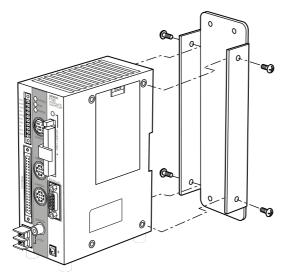


Mounting the Controller

 

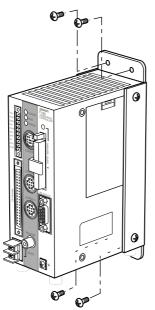

 


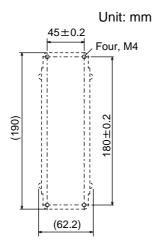

Mounting the Controller


2-3-3 Side Surface-mounting

The F160 Controller can be side-mounted directly to a panel as shown in the following diagram.

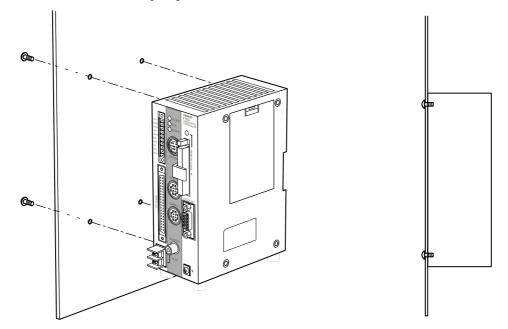


Use the holes and dimensions shown in the following diagram.



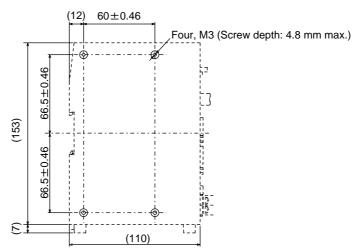


2-3-4 Bottom Surface-mounting

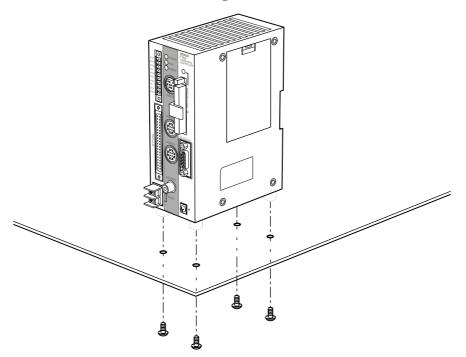

 Use the holes and dimensions shown in the following diagram.





2-4 Connecting Peripheral Devices


This section shows how to connect peripheral devices to the F160.

Precaution Always turn OFF the power supply before connecting or disconnecting a peripheral device's cable. The peripheral device may be damaged if it is connected while the power is ON.

Overview of Available Cameras


2-4-1 Connecting a Console

Connect the Console to the F160's CONSOLE connector. An F160-KP or F150-KP Console can be connected.

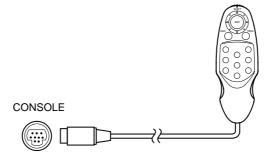

2-4-2 Connecting a Monitor

Connect the monitor cable to the F160's MONITOR connector, and attach the enclosed Ferrite Core to the monitor cable. The Ferrite Core should be attached to the cable approximately 10 mm from the MONITOR connector.

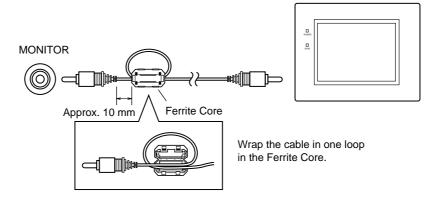

2-4-3 Connecting a Camera

Connect the camera cable to the F160's CAMERA connector.



Note The connector is capped when the F160 is shipped. When not using the connector, leave the cap in place to protect against dust, dirt, and static electricity.

2-5 Overview of Available Cameras

The F160 Camera with Light is a special F160 Camera that has a special lens and light source already attached. The light source and lens are contained in a single unit, so installation is very simple. Just mount the Camera at the proper distance from the measurement object and it is ready to use.

Overview of Available Cameras

Section 2-5

Camera with Light

ltem	F150-SL20A	F150-SL50A
Field of vision	20 mm × 20 mm	50 mm × 50 mm
Mounting distance	61 to 71 mm	66 to 76 mm
Relationship between Camera and object	Measurement object	
Lighting precautions	None in particular	

Camera with Intelligent Lighting

ltem	F150-SLC20 or F160-SLC20	F150-SLC50 or F160-SLC50
Field of vision	20 mm × 20 mm	50 mm × 50 mm
Mounting distance	15 to 25 mm	16.5 to 26.5 mm
Relationship between Camera and object	Measurement object Field of vision	;e
Lighting precautions	Use with DIP switch pins 1 and 2 both set to OFF.	Use with DIP switch pins 1 and 2 both set to OFF.

Camera Only

ltem	F150-S1A or F160-S1
Field of vision and distance to object	Determine the required field of vision based on the size of the measurement object and select an appropriate CCTV lens (C mount).
Lighting precautions	Provide a light source appropriate for the measurement object.

CHECK

Observe the following precautions when using a Camera with Light or Camera with Intelligent Lighting.

Power Supply and Ground

- The lens has a fixed focal point. The actual field of vision and focal point vary from lens to lens, so adjust the distance to the measurement object after replacing the lens or camera.
- The camera mounting distance listed in the following tables is an approximate value. Mount the Camera so that the distance to the measurement object can be adjusted easily.

If the object size and field of vision are incompatible, use a standard CCTV lens and light source.

SeeAlso page 22

 
2-6 Power Supply and Ground

 
Wire the power supply and the ground to their respective terminals. Tighten the screws to a torque of between $0.49 \text{ N} \cdot \text{m}$.

After wiring, confirm that the wiring is correct.

2-6-1 Crimp Terminals and Cables

The terminal block uses M3 terminal screws. Use appropriate crimp terminals for M3 screws, as shown below.






2-6-2 Ground (Earth) Wiring

Always connect a ground wire to the F160's ground terminal. To avoid grounding problems, do not share the ground wire with any other devices or wire the ground to the building's steel framing.

Use a grounding point that is as close as possible and keep the ground wire as short as possible.

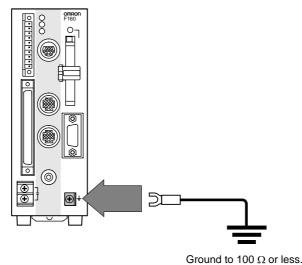


2-6-3 Wiring the Power Supply

Wire the Power Supply Unit independently of other devices. In particular, keep the power supply wired separately from inductive loads. Also, keep the power supply wiring as short as possible (less than 10 m).

Use a power supply that meets the following specifications. We recommend using OMRON's S82K-05024 Power Supply.

ltem	Specification
Output current	1.6 A min.
Power supply voltage	24 VDC ^{+10%} / _{-15%}

CHECK Use a DC power supply with countermeasures against high voltages (safe extra low-voltage circuits on the secondary side). If the system must meet UL standards, use a UL class II power supply.

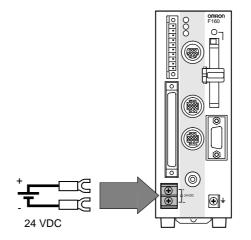

Caution After wiring, replace the protective cover on the power supply terminals.

SECTION 3 Lenses, Lighting, and Memory Cards

This section provides additional information on CCTV lenses, lighting, and Memory Cards.


3-1	CCTV I	Lenses	22	
	3-1-1	Optical Chart	22	
	3-1-2	Lenses and Lens Diameters	23	
	3-1-3	Extension Tubes	24	
3-2	-2 Lighting			
	3-2-1	Lighting Methods	24	
	3-2-2	Fluorescent Light Source	26	
3-3	Memory	/ Cards	27	
	3-3-1	Installing a Memory Card	27	
	3-3-2	Removing the Memory Card	27	
	3-3-3	Using Memory Cards in a Personal Computer	28	

3-1 CCTV Lenses

When using a Camera without a light (F150-S1A or F160-S1), refer to the following graph to select the appropriate Lens and Extension Tube. The lens will differ depending on the size of the measurement object and the distance from the Camera.

3-1-1 Optical Chart


The values in the following chart are approximations, and the Camera must be adjusted after it is mounted.

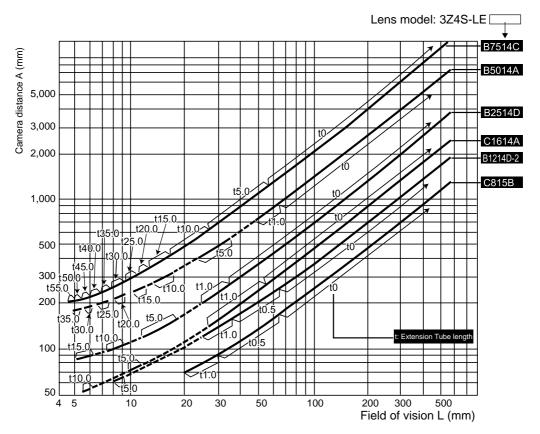


The X axis of the graph shows field of vision L (mm), and the Y axis shows the camera distance A (mm). The curves on the graph show the relationship between the field of vision and camera distance for each CCTV lens. The values are significantly different for each lens, so double-check the model of the lens before using the graph. The "t" values indicate the lengths of the Extension Tubes. The value "t0" shows the case where an Extension Tube is not needed and the value "t5.0" shows the case where a 5-mm Extension Tube is used.

Example

When a 3Z4S-LE B2514D CCTV Lens is being used and a field of vision of 70 mm is needed at the measurement object, a camera distance of 500 mm and 1-mm Extension Tube are required.

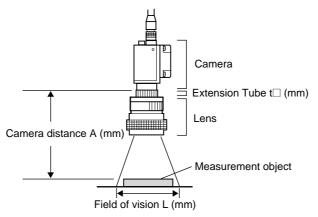


3-1-2 Lenses and Lens Diameters

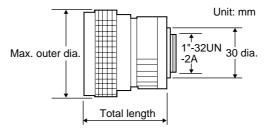

Lens	Focal length	Bright- ness	Maximum outer diameter	Total length	Filter size
3Z4S-LE C418DX	4.8 mm	F1.8	40.5 mm dia.	35.5 mm	
3Z4S-LE B618CX-2	6.5 mm	F1.8	48 mm dia.	42 mm	
3Z4S-LE C815B	8.5 mm	F1.5	42 mm dia.	40 mm	M40.5 × P0.5
3Z4S-LE B1214D-2	12.5 mm	F1.4	42 mm dia.	50 mm	-
3Z4S-LE C1614A	16.0 mm	F1.4	30 mm dia.	33 mm	M27 × P0.5
3Z4S-LE B2514D	25.0 mm	F1.4	30 mm dia.	37.3 mm	
3Z4S-LE B5014A	50.0 mm	F1.4	48 mm dia.	48 mm	M46 × P0.75
3Z4S-LE B7514C	75.0 mm	F1.4	62 mm dia.	79 mm	M58 × P0.75

3-1-3 Extension Tubes

One or more Extension Tubes can be inserted between the lens and the Camera to focus the Camera image. Use a combination of one or more of the six tubes to achieve the required length.

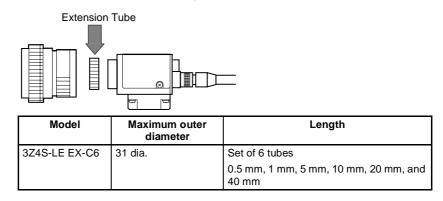

Length: 40 mm 20 mm 10 mm 5 mm 1.0 mm 0.5 mm



Precaution

- Do not use the 0.5-mm and 1.0-mm Extension Tubes attached to each other. Since these Extension Tubes are placed over the threaded section of the Lens or other Extension Tube, the connection may loosen when more than one 0.5-mm or 1.0-mm Extension Tube are used together.
 - Reinforcement may be required for combinations of Extension Tubes exceeding 30 mm if the Camera is subject to vibration.

3-2 Lighting


A stable image must be obtained to ensure accurate inspection. Use appropriate lighting for the application and the measurement object if using a Camera without a light (F150-S1A or F160-S1).

3-2-1 Lighting Methods

Back Lighting

A stable, high-contrast image can be obtained using back lighting.



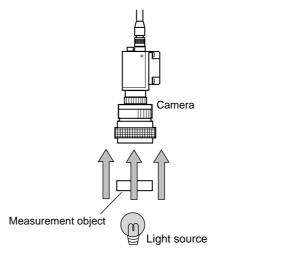


Reflected Lighting

Ring Lights


Light is shone uniformly on the measurement object.


Applications: Surface inspections

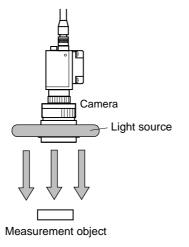

Oblique Lighting

 Detection can be made utilizing the difference in regular and diffuse reflected light.




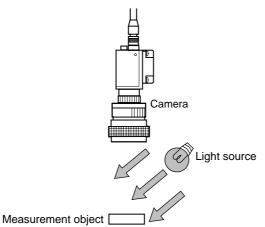

Coaxial Lighting

A stable image can be obtained with few shadows from uneven surfaces on the measurement object.

Applications: Surface inspections, positioning, and hole inspections of comparatively small objects

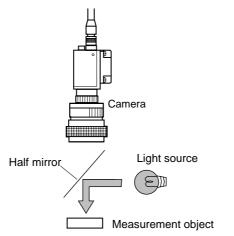

Fluorescent Light Source 3-2-2

ltem	Specification	
Lamp	FCL15EX-D 15-W Ring-shaped fluorescent	
Average lamp lifetime	5,000 h	
Cord length	1.2 m from power supply to light	
Light method	High-frequency light, 47 kHz	
Operating temperature	0 to 50°C	

Caution Do not touch a fluorescent light while the power is ON or just after the power is turned OFF. These lights can cause burns.

3-3 Memory Cards

Use a Memory Card to backup data such as settings and image data or increase the number of scenes when you are using the Scene Group function. Data from the F160 can be backed up in the PLC just by inserting the Memory Card into the PLC and copying the desired data.


We recommend the OMRON F160-N64S (64 MB) and QM300-N128S (128 MB) Memory Cards.

CHECK A filler card with no memory is inserted into the F160's Memory Card slot before the F160 is shipped. Remove this filler card and install a Memory Card to use this function.

If Memory Cards are not being used, leave the filler card in place to prevent dust or dirt from entering the Memory Card slot.


3-3-1 Installing a Memory Card

1. Open the Memory Card slot's card lock.

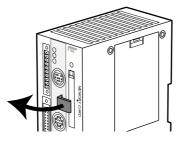


CHECK

- Do not force the lock open; lift the latch gently.
- 2. Insert the Memory Card.

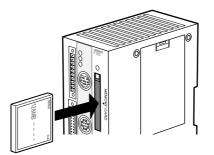

3. Close the card lock to secure the Memory Card.

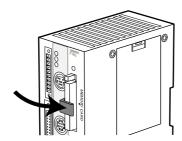


3-3-2 Removing the Memory Card

1. Stop the power supply to the Memory Card or turn OFF the F160.

Memory Cards		Section 3-3
SeeAlso		Refer to the Conversational Menu Operation Manual or the Expert Menu Operation Manual for details on turning OFF the power supply to the Memory Card.
	2.	Verify that the Memory Card indicator is not lit.
		Memory Card indicator
Precaution		Do not remove the Memory Card if the Memory Card indicator is lit. Doing so may damage the Memory Card or the F160 itself.

3. Open the card lock.

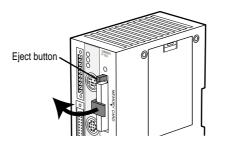


- 4. Press the eject button over the Memory Card slot.
- 5. Pull the Memory Card straight out from the slot.

3-3-3 Using Memory Cards in a Personal Computer

The F160's Memory Cards can be used in a personal computer with a PC Card drive (PCMCIA 2.0 or higher, type II compatible) or "Compact Flash" drive.

The Memory Card must be inserted into a PC Card Adapter in order to be used in a PC Card drive. We recommend the OMRON HMC-AP001 PC Card Adapter.

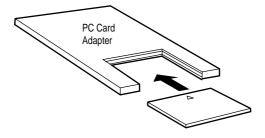

SECTION 4 Connecting External Devices

This section describes how to connect external devices through a parallel interface (the I/O terminals or I/O connector) or serial interface (the RS-232C/RS-422 connector).

4-1 Connecting through the Parallel Interface		ting through the Parallel Interface	30
	4-1-1	I/O Terminal Connections	30
	4-1-2	I/O Connector Connections	31
	4-1-3	I/O Specifications	33
4-2	Connec	cting through the Serial Interface	34
	4-2-1	Connection Examples	35
	4-2-2	Connector	36
	4-2-3	Wiring	36
	4-2-4	Connection	37

4-1 Connecting through the Parallel Interface

This section explains how to connect I/O to the F160 through its parallel interface to input signals such as measurement triggers or output signals such as measurement results.

Either the I/O terminals or I/O connector can be used for the parallel interface. The I/O terminals and I/O connector cannot be used simultaneously.

I/O Terminals


When the required control signals are being connected to the I/O terminals, attach the control wires to the included connector (Phoenix MC1.5/10-STF-3.5) and then insert the connector into the F160.

I/O Connector

When you want to use the parallel interface to input commands and output measurement results, prepare a parallel I/O cable and connect it to the I/O connector. Refer to the *Communications Reference Manual* for details on communications settings and I/O formats.

4-1-1 I/O Terminal Connections


Wire the cable carrying the control signals to the connector that was included with the F160 and insert the connector into the F160. The following diagram shows the I/O allocation of the F160's I/O terminals. Just wire the terminals that are needed.

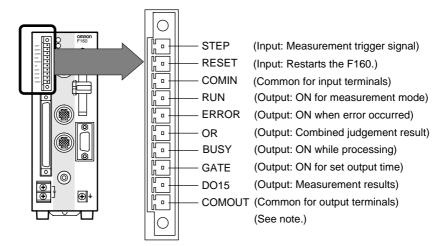


- Note 1. COMOUT is connected to COMOUT1 and COMOUT3 of the I/O connector.
 - 2. Use wire of cross-sectional area 0.14 to 1.5 mm² (AWG 24 to AWG 16) with a cable length not exceeding 30 m.
- **Precaution** Do not input the RESET input immediately after turning ON the power. When using RESET input to synchronize startup timing, wait at least 1 s after turning ON the F160's power supply before turning ON the RESET signal.
 - **CHECK** Use a DC power supply with countermeasures against high voltages (safe extra low-voltage circuits on the secondary side) for the COMIN terminal. If the system must meet UL standards, use a UL class II power supply.

Wiring the Connector


1. Use a flat-blade precision screwdriver to loosen the connector's set screw.

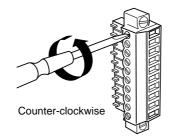

2. Insert the signal wire.

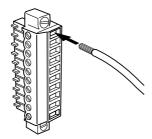

3. Tighten the set screw to secure the wire. Tighten to a torque of 0.22 to 0.25 N•m.

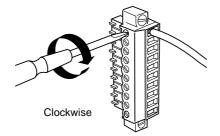



- 4. Insert the connector into the F160.
- 5. Tighten the connector's mounting screws. Tighten to a torque of 0.22 to 0.25 N•m.

4-1-2 I/O Connector Connections

Use an F160-VP Parallel I/O Cable (sold separately) to connect to the F160's I/O connector. Align the connectors and insert the cable's connector straight

 Section 4-1



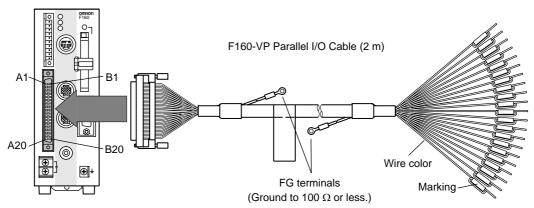

Precaution

Turn OFF the power supply before connecting or disconnecting the Parallel I/O Cable. Peripheral devices may be damaged if the cable is connected or disconnected with the power ON.

Pin	Signal	Wire color	Marking	Function
A1	RESET	Light brown	(black)	Restarts the F160.
A2	STEP	Yellow	(black)	Measurement trigger signal input
A3	DI0	Green	(black)	Command input
A4	DI2	Gray	(black)	
A5	DI4	White	(black)	
A6	DI6	Light brown	■■ (black)	
A7	DI8	Yellow	■■ (black)	
A8	STGOUT0	Green	■■ (black)	Strobe trigger output (See note 1.)
A9	RUN	Gray	■■ (black)	ON while in Run Mode
A10	BUSY	White	■■ (black)	ON during processing
A11	OR	Light brown	■■■ (black)	Combined judgement result
A12	DO0	Yellow	■■■ (black)	Data output
A13	DO2	Green	■■■ (black)	
A14	DO4	Gray	■■■ (black)	
A15	DO6	White	■■■ (black)	
A16	DO8	Light brown	■■■■ (black)	
A17	DO9	Yellow	■■■■ (black)	
A18	DO11	Green	■■■■ (black)	
A19	DO13	Gray	■■■■ (black)	
A20	DO15	White	■■■■ (black)	
B1	COMIN	Light brown	■ (red)	Common for input signals
B2	DSA	Yellow	■ (red)	Data send request signal input
B3	DI1	Green	■ (red)	Command input
B4	DI3	Gray	■ (red)	
B5	DI5	White	■ (red)	
B6	DI7	Light brown	■■ (red)	
B7	DI9	Yellow	■■ (red)	
B8	RESERVED	Green	■■ (red)	Do not connect.
B9	ERROR	Gray	■■ (red)	ON when an error occurred.
B10	GATE	White	■■ (red)	ON for the set output time.

Connecting through the Parallel Interface

Section 4-1

Pin	Signal	Wire color	Marking	Function
B11	COMOUT1	Light brown	■■■ (red)	Common for control signals (See note 2.)
B12	DO1	Yellow	■■■ (red)	Data output
B13	DO3	Green	■■■ (red)	
B14	DO5	Gray	■■■ (red)	
B15	DO7	White	■■■ (red)	
B16	COMOUT2	Light brown	■■■■ (red)	Common for DO0 to DO7
B17	DO10	Yellow	■■■■ (red)	Data output
B18	DO12	Green	(red)]
B19	DO14	Gray	■■■■ (red)	
B20	COMOUT3	White	■■■■ (red)	Common for DO8 to DO15

Note 1. Use the STGOUT0 signal when you want to connect a strobe device to the F160.

SeeAlso For details, refer to page 64.

2. Pins A8 to A11 and B9 to B10 are for control signals.

- **Precaution** Do not input the RESET input immediately after turning ON the power. When using RESET input to synchronize startup timing, wait at least 1 s after turning ON the F160's power supply before turning ON the RESET signal.
 - **CHECK** Use a DC power supply with countermeasures against high voltages (safe extra low-voltage circuits on the secondary side) for the COMIN terminal. If the system must meet UL standards, use a UL class II power supply.

Making a Parallel I/O Cable

A parallel I/O cable can be assembled using the connector and cover listed in the following table or equivalent components. Keep the cable length less than 30 m.

Component	Manufacturer	Model number
Connector	Fujitsu	FCN-360J040-AU
Cover	Fujitsu	FCN-360C040-B


CHECK Double-check the connector wiring for mistakes before turning ON the power supply for the first time.

4-1-3 I/O Specifications

Input Specifications

ltem		Specification	
Model	F160-C10E (NPN mode)	F160-C15E (PNP mode)	
Input voltage	12 to 24 VDC ±10%	12 to 24 VDC ±10%	
ON current	3 to 15 mA	3 to 15 mA	
ON voltage	8.8 V max.		
OFF current	0.1 mA max.	0.1 mA max.	
OFF voltage	4.5 V min.		
ON delay	RESET input: 10 ms max.	RESET input: 10 ms max.	
	Other inputs: 0.5 ms max.		

Connecting through the Serial Interface

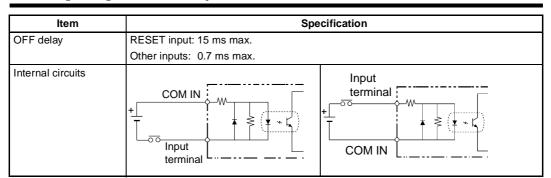


Output Specifications

ltem	Spe	cification
Model	F160-C10E (NPN mode)	F160-C15E (PNP mode)
Output voltage	12 to 24 VDC ±10%	
Load current	45 mA max.	
ON residual voltage	2 V max.	
OFF leakage current	0.1 mA max.	
Internal circuits	Output terminal	COM OUT Load Output terminal

CHECK

The I/O contacts are shared by the I/O terminals and I/O connector. The following diagram shows the wiring diagram for the STEP signal as an example.

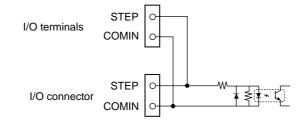

4-2 Connecting through the Serial Interface

 
The F160's serial interface (RS-232C/RS-422 connector) can be used to connect input signals such as measurement triggers or output signals such as measurement results. Additionally, data that has been set in the F160 can be backed up in a personal computer.

Refer to the *Communications Reference Manual* for details on communications settings and I/O formats.

Connecting through the Serial Interface


4-2-1 Connection Examples

1:1 Connection (No-protocol, Menu Operation)




Multi-drop Connection (No-protocol)

Communications between one computer and several F160s is possible using Link Adapters.

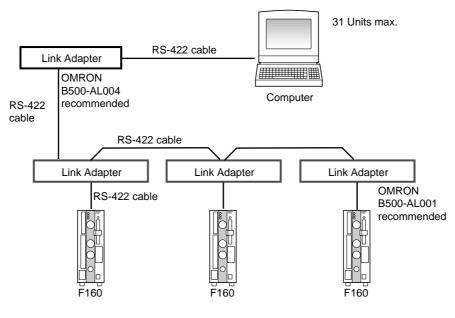


1:1 Connection (Host Link)

 

Section 4-2

4-2-2 Connector

 The F160's RS-232C/RS-422 Connector is a 9-pin D-SUB female connector. The pin allocation is shown below.



Pin	Signal	Name
1	FG	Protective frame ground
2	SD	For RS-232C
3	RD	
4	NC	Not connected
5	RDB(+)	For RS-422
6	RDA(-)	
7	SDB(+)	
8	SDA(-)	
9	GND	Signal ground


The following plug and hood are recommended and are available from $\ensuremath{\mathsf{OMRON}}$.

Model	Model No.
Plug	XM2A-0901
Hood	XM2S-0911

4-2-3 Wiring


The maximum cable length is 15 m for RS-232C or RS-422

RS-232C Wiring

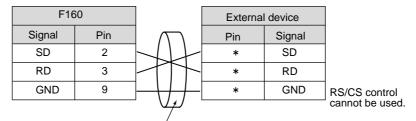

Use only shielded cable.

RS-422 Wiring

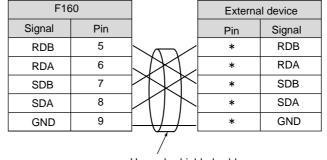


Use only shielded cable.

Note Pin numbers on the external device will depend on the device being connected. Refer to the manual for the personal computer or PLC being connected.

4-2-4 Connection

Align the connector with the socket and press the connector straight into place. Tighten the two mounting screws to secure the connector.

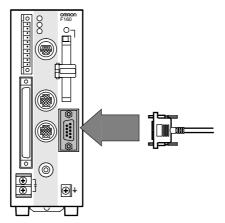

Precaution Always turn OFF the power supply before connecting or disconnecting cables. The peripheral device may be damaged if connected or disconnected with the power supply turned ON.

Note The connector is capped when the F160 is shipped. When not using the serial interface, leave the cap in place to protect against dust, dirt, and static electricity.

SECTION 5 Troubleshooting and Maintenance

This section provides tables to help identify and correct hardware errors that may occur with the F160 as well as information on maintenance and periodic inspections.

5-1	Trouble	shooting	40
5-2	Maintenance		
	5-2-1	Replacing the Light	41
	5-2-2	Replacing the Battery	43
5-3	Regular	Inspections	44
5-4	Specifications		
5-5	F200/F3	300 Camera Parameters	63
5-6	Connecting a Strobe Device		

5-1 Troubleshooting

5-1-1 Connection Errors

Problem	Probable cause
The POWER indicator is not lit.	The Power Supply is not connected properly.
	The supply voltage is not 24 VDC ^{+10%} / _{-15%} .
The Video Monitor is blank.	The power to the Video Monitor is not ON.
	The Monitor Cable is not connected properly.
	The Video Monitor is malfunctioning.
	When using an LCD Monitor, the power supply capacity is insufficient.
The Video Monitor image is not	There is electrical noise entering from the power supply or cables.
clear.	The Monitor Cable is not correctly connected.
Cannot make key inputs from the Console.	The Console Cable is not correctly connected.
Camera images do not appear on	The Camera Cable is not correctly connected.
the screen (for Cameras with Light Source).	The lighting cable is not properly connected to the Camera.
Camera images do not appear on	The lens cap has not been removed.
the screen (when a standard CCTV lens and lighting are used).	The Camera Cable is not properly connected.
iens and igning are used).	The lens iris is opened or closed too far.
	The shutter speed is not suitable.
	The lighting method is not suitable.
The indicators do not turn ON (for	The lighting cable is not correctly connected to the Camera.
Cameras with Light Source).	Power is not being supplied to the F160.
	When using a Camera with Intelligent Lighting, the DIP switch pins are not set to 0.

5-1-2 Menu Operation Errors

Problem	Probable cause
The measurement results are not displayed on the Video Monitor.	The F160 is not in Monitor or Run mode.

5-1-3 Parallel Interface Errors

Problem	Probable cause
Trigger signals (input signals) are not received.	The cables are not correctly wired.
	The signal line is disconnected. The status of communications can be checked with the I/O monitor.
	The F160 is not in Monitor or Run mode.
Signals cannot be output externally.	The trigger signal has not been input.
	The cables are not correctly wired.
	The signal line is disconnected. The status of communications can be checked with the I/O monitor.
	The F160 is not in Run mode.

Maintenance

5-1-4 Serial Interface Errors

Problem	Probable cause
No communications are possible.	The cables are not correctly wired.
	The F160's communications specifications do not match those of the external device.
	The communications mode was not selected under System/Communica- tions settings/Serial.
	Select Normal , Host link , or Menu operations under RS-232C/Operat- ing mode. (Normal is no-protocol.)
	The status of communications can be checked with the I/O monitor.
The Unit operates well initially, but after a while there is no response from the F160.	The reception buffer on the external device (e.g., computer) is full. Check that settings allow the data to be properly received.
Cannot perform menu operations from the computer.	The communications mode was not set to <i>Menu operations</i> in the System/Communications settings/Serial settings.

5-1-5 Cabling Errors

Problem	Probable cause
A recommended OMRON RS-232C cable is not being used.	One of the following OMRON cables can be used. Select a cable that works with the device being connected.
	Connecting to a PC/AT or compatible computer (9-pin connector)
	 XW2Z-200S-V (2 m) XW2Z-500S-V (5 m)
	Connecting to a SYSMAC device (9-pin connector)
	• XW2Z-200T (2 m)
	• XW2Z-500T (5 m)


5-2 Maintenance

5-2-1 Replacing the Light

- The Light will gradually lose brightness over time (about 20% loss after 1,500 hours of use). Replace the Light after about 1,500 hours of use.
- Replace the Light if it is damaged or not fully functional.

F150-SL20A/SL50A


Use the following procedure to replace a Light with the F150-LT10A Light. (The F150-LT10A cannot be connected to the older F150-S1 Camera.)

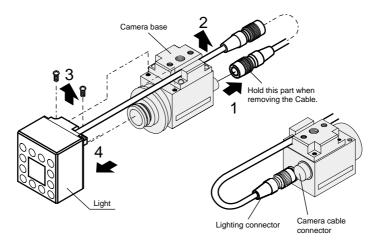

- 1. Disconnect the light cable from the light connector on the back of the Camera.
- 2. Remove the light cable from the slot in the camera base.
- 3. Remove the two screws securing the Light.
- 4. Remove the Light from the Camera.
- 5. Reverse steps 1 through 4 when installing the Lens and Light.
- **Precaution** Do not disassemble the Lens. Disassembly can damage the Lens.

F150-SLC20/SLC50 or F160-SLC20/SLC50


Use the following procedure to replace a Light with an F150-LTC20 (20-mm field of vision) or F150-LTC50 (50-mm field of vision) Light.

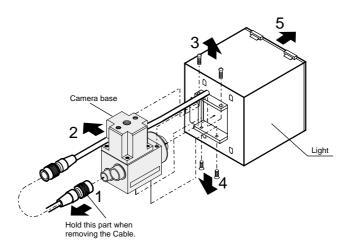


- 1. Disconnect the light cable from the light connector on the back of the Camera.
- 2. Remove the light cable from the slot in the camera base.
- 3. Remove the two screws securing the Light at the top.
- 4. Remove the two screws securing the Light at the bottom.

Maintenance	Section 5-2
	 Remove the Light from the Camera. Reverse steps 1 through 4 when installing the Lens and Light.
Precaution	Do not disassemble the Lens. Disassembly can damage the Lens.
CHECK	When you want to use the Camera alone without connecting an Intelligent Lighting, use $M2 \times 3$ screws in the bottom of the Camera instead of the long screws removed in step 4. The screws removed in step 3 are not needed.
5-2-2 Repla	icing the Battery
	The F160 contains a battery that backs up the time and date information. When the battery is nearly discharged, the message "BATTERY LOW" will be displayed at startup. Replace the battery with an OMRON 3Z49-BAT1 Battery. Dispose of the spent battery properly.
CHECK	 Always turn OFF the power supply before replacing the battery.
	 The F160's clock will be reset if the new battery is not connected within 2 minutes of removing the spent battery. If the clock is inadvertently reset, the time and date will have to be set again.
SeeAlso	Refer to the Conversational Menu Operation Manual or the Expert Menu Operation Manual for details.
Replacement Proce	edure

1. Open the battery cover on the side of the F160. The cover can be opened with a small flat-blade screwdriver.

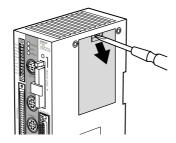

2. The battery is mounted to the inside of the battery cover. Hold the battery connector by its base and pull it off.

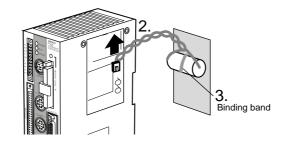

- 3. Cut the binding band that secures the battery and remove it from the cover.
- 4. Reverse steps 1 through 3 to install the new battery. Use the new binding band included with the new battery to attach it to the battery cover.

Regular Inspections	Section 5-3
⚠ Caution	Do not short the battery terminals, recharge the battery, disassemble, crush, or dispose of the battery in fire. Doing so may cause the battery to start a fire,

5-3 Regular Inspections

leak, or explode.

To maintain the F160 in the best condition, perform the following regularly.

- Clean the Lens and LED indicators with a lens-cleaning wipe or blow off dust with an aerosol air sprayer.
- Lightly wipe off dirt with a soft cloth.

Inspection point	Details	Tools required
Power supply	The voltage measured at the power supply terminals must be 24 VDC $^{+10\%}/_{-15\%}$.	Circuit tester
Ambient tempera- ture	The operating ambient temperature inside the cabinet must be between 0 and 50°C.	Thermometer
Ambient humidity	The operating ambient humidity inside the cabinet must be between 35% and 85%.	Hygrometer
Installation	Each component must be firmly secured.	Phillips screwdriver
	Each cable connector must be correctly inserted and locked.	
	The Cameras must be firmly secured.	
	The camera lens mounts must be firmly secured.	
Indicators	All indicators must light when the power is turned ON.	
	Verify that a through-image is displayed.	
	When using an Intelligent Lighting, verify that the light level settings are set to their maximum values.	


Precaution

• Turn OFF the power and take safety precautions before conducting inspections. Electrical shock can result from attempting safety inspections with the power turned ON.

• Do not use thinners or benzene to clean the F160. They will damage F160 components.

This section provides the specifications and dimensions of the F160 and its peripheral devices.

F160-C10E/C15E Vision Mate Controller

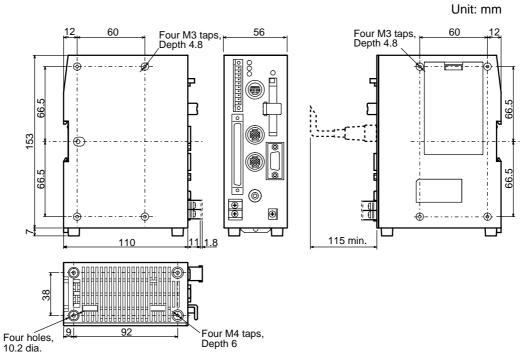


ltem	Specif	ication
Model	F160-C10E	F160-C15E
Input/Output type	NPN	PNP
Supply voltage	20.4 to 26.4 VDC	
Current consumption	1.6 A max.	
Insulation resistance	20 M Ω min. between all DC external termination internal surge absorber removed)	als and GR terminal (100 VDC Megger, with
Dielectric strength	1,000 VAC, 50/60 Hz between all DC externations surge absorber removed)	al terminals and GR terminal (with internal
Leakage current	10 mA max.	
Noise resistance	2,000 V; pulse width: 50 ns; rise time: 5 ns (pulse)
	Burst continuation time: 15 ms; Period: 300	ms
Vibration resistance	10 to 150 Hz; half-amplitude: 0.35 mm; maximum acceleration: 50 m/s ² , 10 times for 8 minutes each in 3 directions (except for bottom surface-mounting.)	
Shock resistance	150 m/s ² , 3 times each in 6 directions	
Ambient temperature	Operating: 0 to 50 °C (with no condensation Storage: -25 to 65°C (with no condensation)	
Ambient humidity	Operating and storage: 35% to 85% (with no	condensation)
Ambient environment	No corrosive gases	
Ground	Class 1 (Ground resistance 100 Ω max.)	
Degree of protection	IEC60529 IP20 (in-panel)	
Case material	ABS/PC	
Weight	Approx. 570 g (Controller only)	


Section 5-4


F150 Cameras


Cameras with Light

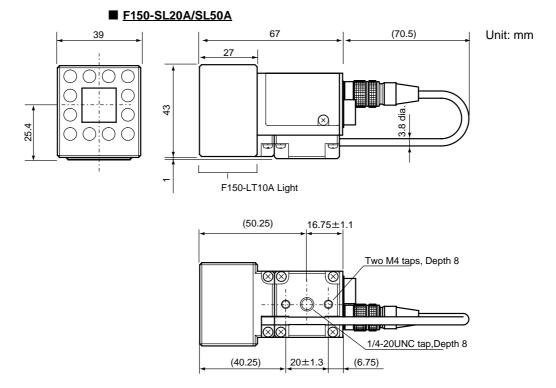




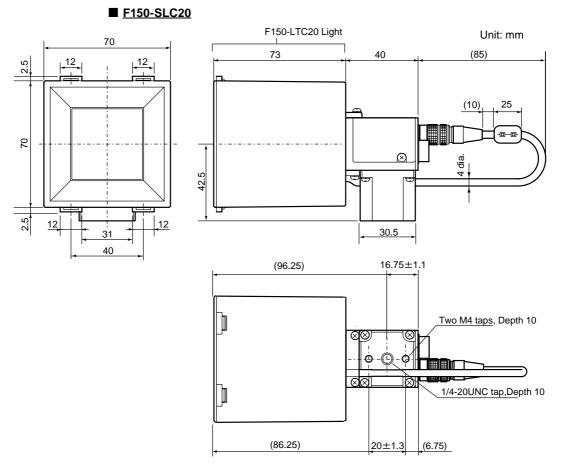

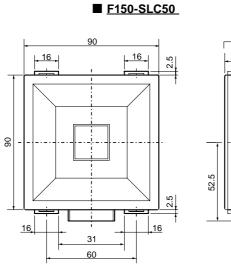

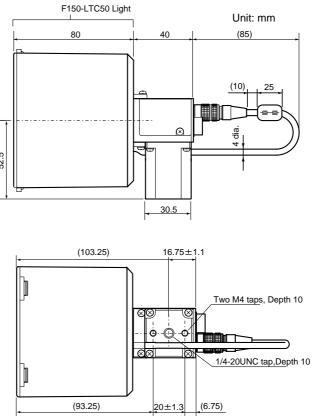



Camera Only

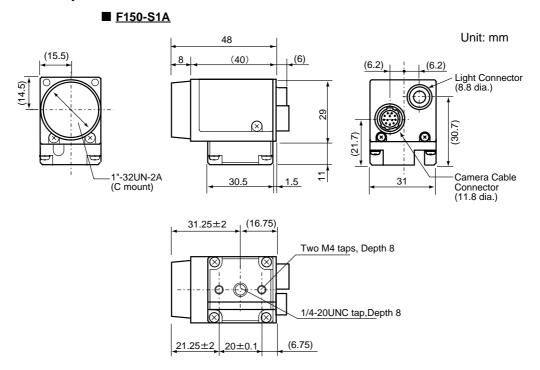


F160 Cameras


Cameras with Intelligent Lighting

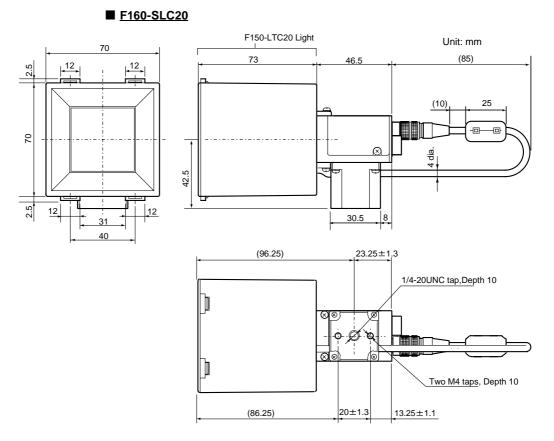

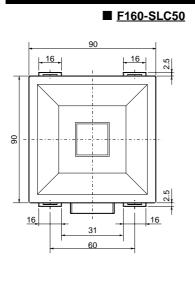

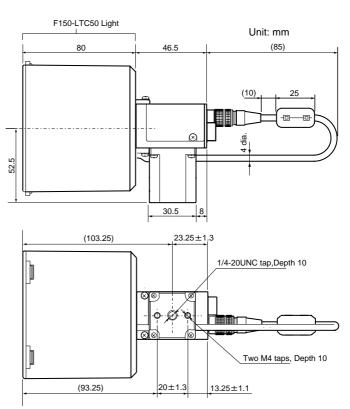

Camera Only

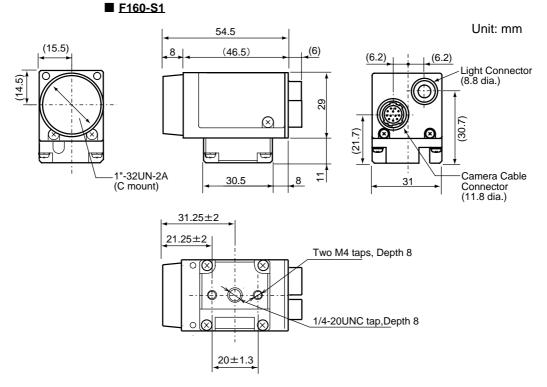

51

Camera Specifications

General Specifications

Item	Specification
Supply voltage	F150-series: 12 VDC F160-series: 13 VDC
Current consumption	F150-S1A: 100 mA max. F150-SL20A/SL50A: 110 mA max. F150-SLC20/SLC50: 200 mA max. F160-S1: 130 mA max. F160-SLC20: 260 mA max. F160-SLC50: 310 mA max.
Vibration resistance	10 to 150 Hz; half-amplitude: 0.35 mm; maximum acceleration: 50 m/s ² , 10 times for 8 minutes each in 3 directions
Shock resistance	150 m/s ² , 3 times each in 6 directions
Ambient temperature	Operating: 0 to 50 °C (with no condensation) Storage: -25 to 65 °C (with no condensation)
Ambient humidity	Operating and storage: 35% to 85% (with no condensation)
Ambient environment	No corrosive gases
Camera materials	Cover: Galvanized steel sheet metal Case: Die-cast aluminum alloy Camera mounting base: Fiber-reinforced plastic (black)
Light materials (Cameras with Lights)	Case: ABS Transparent cover: PC
Weight	F150-S1A: Approx. 80 g F150-SL20A/SL50A: Approx. 135 g F150-SLC20: Approx. 280 g F150-SLC50: Approx. 370 g F160-S1: Approx. 85 g F160-SLC20: Approx. 285 g F160-SLC50: Approx. 375 g

Characteristics

Camera Characteristics

ltem	Specification
Picture element	1/3" Interline CCD (reading all pixels)
Effective pixels	$659 \times 494 (H \times V)$
Synchronization	External sync. via horizontal sync signal
Shutter speed	F150-series: 1/100 s, 1/500 s, 1/2000 s, 1/10000 s
(Electronic shutter)	F160-series: 1/120 s, 1/200 s, 1/500 s, 1/1000 s, 1/2000 s, 1/4000 s, 1/8000 s, 1/20000 s
Lens mounting	C mount

■ Lens Characteristics (Cameras with Lights only)

ltem	Specification	
Lens model	F150-SL20A: F150-LE20 F150-SL50A:F150-LE50 F150-SLC20:F150-LE20 F150-SLC50:F150-LE50 F160-SLC20:F150-LE20 F160-SLC50:F150-LE50	
Method	Fixed focal point, fixed iris	

SpecificationsSection 5-4ItemSpecificationBrightnessF2.8Focal point distanceF150-SL20A: 13 mm
F150-SL20A: 6.1 mm
F150-SLC20:13 mm
F150-SLC20:13 mm
F160-SLC20:13 mm
F160-SLC20:13 mm
F160-SLC50: 6.1 mm

■ Light Characteristics (Cameras with Lights only)


ltem	Specification	
Light model	F150-SL20A/SL50A: F150-LT10A F150-SLC20:F150-LTC20 F150-SLC50:F150-LTC50 F160-SLC20:F150-LTC20 F160-SLC50:F150-LTC50	
Light source	F150-SL20A/SL50A: Red LED (Peak emission wavelength: 680 nm)	
	F150-SLC20/SLC50 and F160-SLC20/SLC50: Red and green LED combination (Peak emission wavelengths: 660 nm and 570 nm)	
Light emission method	Pulse emission (synchronized with the camera shutter)	

Other Characteristics


Item	Specification
Mounting distance	F150-S1A: Depends on lens being used. F150-SL20A: 61 to 71 mm F150-SL50A: 66 to 76 mm F150-SLC20: 15 to 25 mm F150-SLC50: 16.5 to 26.5 mm F160-S1: Depends on lens being used. F160-SLC20: 15 to 25 mm F160-SLC50: 16.5 to 26.5 mm
Field of vision	F150-S1A: Depends on lens being used. F150-SL20A: 20 mm \times 20 mm F150-SL50A: 50 mm \times 50 mm F150-SLC20: 20 mm \times 20 mm F150-SLC50: 50 mm \times 50 mm F160-S1: Depends on lens being used. F160-SLC20: 20 mm \times 20 mm F160-SLC20: 50 mm \times 50 mm F160-SLC20: 50 mm \times 50 mm F160-SLC20: 20 mm \times 20 mm F160-SLC50: 50 mm \times 50 mm

Consoles

■ F150-KP Console

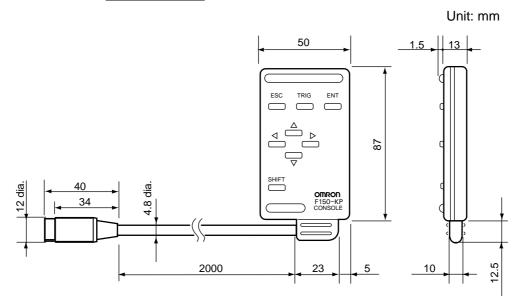


ltem	Specification
Vibration resistance	10 to 150 Hz; half-amplitude: 0.15 mm; 4 times for 8 minutes each in 3 directions
Shock resistance	196 m/s ² ; 3 times each in 6 directions
Ambient temperature	Operating: 0 to 50 °C (with no condensation) Storage: -25 to 65 °C (with no condensation)
Ambient humidity	35% to 85% (with no condensation)
Ambient environment	No corrosive gases
Degree of protection	IEC60529 IP20 (in-panel)
Minimum bending radius	75 mm
Materials	Body: ABS Cable sheathing: Heat-resistant chlorinated vinyl Connector: PC and PBT
Weight	Approx. 135 g

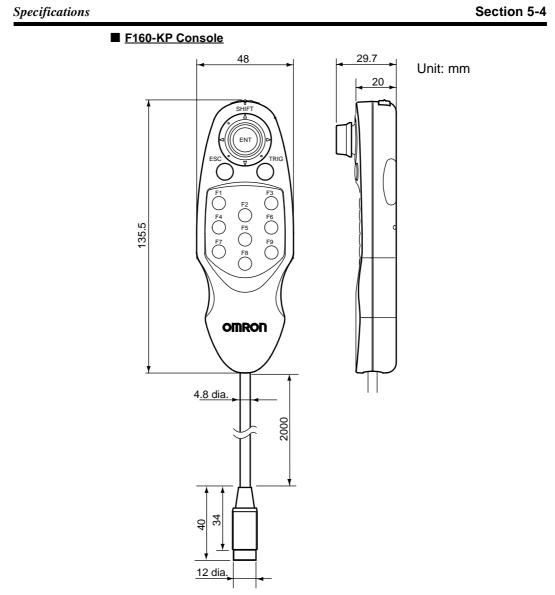

ltem	Specification				
Current consumption	Approx. 10 mA				
Vibration resistance	10 to 150 Hz; half-amplitude: 0.35 mm; maximum acceleration: 50 m/s ² ,10 times for 8 minutes each in 3 directions				
Shock resistance	150 m/s ² ; 3 times each in 6 directions				
Ambient temperature	Operating: 0 to 50 °C (with no condensation) Storage: -25 to 65 °C (with no condensation)				
Ambient humidity	35% to 85% (with no condensation)				
Ambient environment	No corrosive gases				
Degree of protection	IEC60529 IP20 (in-panel)				
Minimum bending radius	75 mm				
Materials	Body: ABS Cable sheathing: Heat-resistant chlorinated vinyl Connector: PC and PBT				
Weight	Approx. 160 g				



 K The switch on the back of the F160-KP must be set to "ENABLE".



 These keys will be disabled if the switch is set to "DISABLE".


<u>Cables</u>

Camera Cables

Camera Cable Specifications


The F150-VS, F160-VSR3, and F160-VSR4 Camera Cables have different dimensions and wiring, but they share the same specifications.

ltem	Specification
Vibration resistance	10 to 150 Hz; half-amplitude: 0.15 mm, 4 times for 8 minutes each in 3 directions
Shock resistance	196 m/s ² , 3 times each in 6 directions
Ambient temperature	Operating: 0 to 50 °C (with no condensation) Storage: -25 to 65 °C (with no condensation)
Ambient humidity	35% to 85% (with no condensation)
Ambient environment	No corrosive gases
Materials	Cable sheathing: Heat-resistant chlorinated vinyl Connector: Fiberglass-reinforced PC and PBT
Minimum bending radius	75 mm
Weight	Approx. 170 g

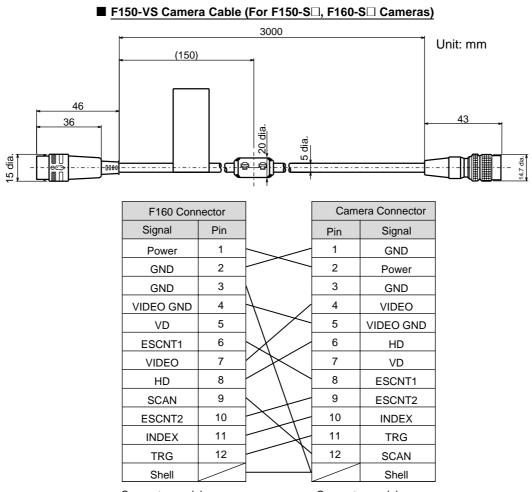


Connector model: Hirose RP17A-13P-12PC Connector model: Hirose HR10A-10P-12S


■ F160-VSR3 Camera Cable (For F300-S2R/S3DR/S4R and F200-S Cameras)

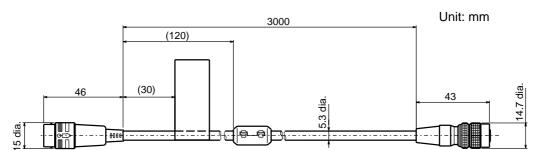

F160 Conr	nector		Cam	era Connector
Signal	Pin		Pin	Signal
Power	1		1	GND
GND	2		2	Power
GND	3	A	3	VIDEO GND
VIDEO GND	4		4	VIDEO
VD	5	\mathbb{N}	5	HD GND
ESCNT1	6		6	HD
VIDEO	7	KHN	7	VD
HD	8		8	GND
SCAN	9		9	_
ESCNT2	10		10	INDEX(SI)
INDEX	11		11	TRG
TRG	12		12	VD GND
Shell		<u>}</u>	\nearrow	Shell

 
Connector model: Hirose RP17A-13P-12PC Connector model: Hirose HR10A-10P-12S



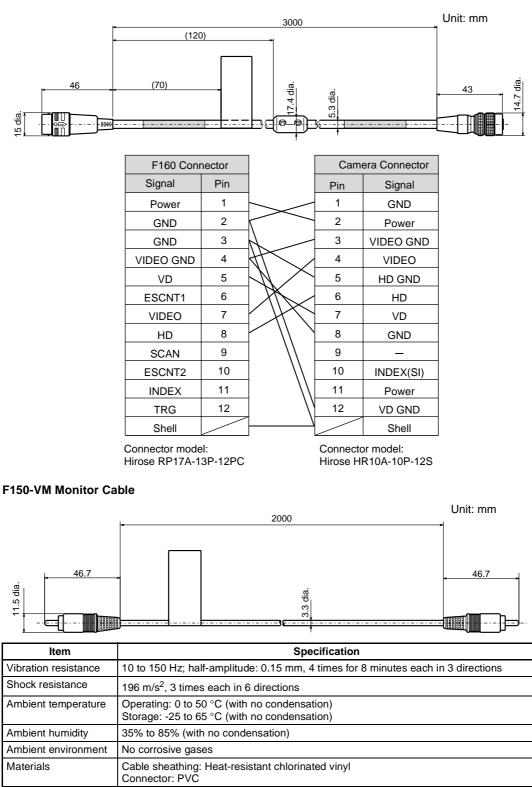


Specifications		Section 5-4
Item	Specifica	ation
Minimum bending radius	50 mm	
Weight	Approx. 40 g	
Accessories	BNC Jack Adapter	

F160-VP Parallel I/O Cable

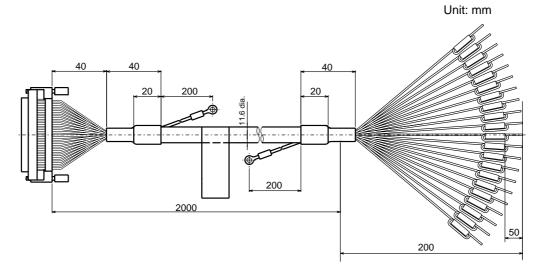

ltem	Specification
Vibration resistance	10 to 150 Hz; half-amplitude: 0.15 mm, 4 times for 8 minutes each in 3 directions
Shock resistance	196 m/s ² , 3 times each in 6 directions
Ambient temperature	Operating: 0 to 50 °C (with no condensation) Storage: -25 to 65 °C (with no condensation)
Ambient humidity	35% to 85% (with no condensation)
Ambient environment	No corrosive gases
Materials	Cable sheathing: Heat-resistant PVC Connector: Polyester resin
Minimum bending radius	120 mm
Weight	Approx. 340 g


F150-M05L LCD Monitor

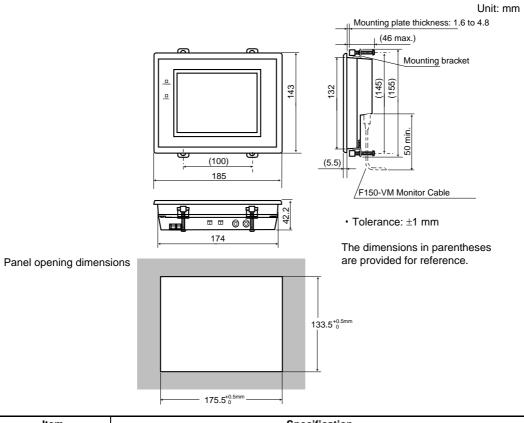

ltem	Specification			
Supply voltage	20.4 to 26.4 VDC			
Current consumption	700 mA max.			
Vibration resistance	10 to 150 Hz; half-amplitude: 0.1 mm; maximum acceleration: 15 m/s ² , 10 times for 8 ninutes each in 3 directions			
Shock resistance	150 m/s ² , 3 times each in 6 directions			
Ambient temperature	Operating: 0 to 50 °C (with no condensation) Storage: -25 to 65 °C (with no condensation)			
Ambient humidity	35% to 85% (with no condensation)			
Ambient environment	No corrosive gases			
Degree of protection	IEC60529 IP20 (in-panel)			
Materials	Case: ABS/PC Display surface: PMMA (Acrylic)			
Panel size	5.5 inches (111.36 × 83.52 mm (H × V))			
Panel type	TFT color liquid crystal			
Resolution	320 × 240 dots			
Image pitch	$0.348 \times 0.348 \text{ mm} (H \times V)$			
Contrast	85:1 (typical)			
Viewable angle	25° up/down and 50° left/right (with a contrast ratio > 10)			
Luminance	250 cd/m ² (typical)			
Backlight	Cold cathode fluorescent light			
Response speed	60 ms max.			
Input signal	NTSC composite video (1.0 V/75 Ω termination)			

Specifications	Section 5-4
ltem	Specification
Weight	Approx. 1 kg
Accessories	Four mounting brackets


F150-M09 Video Monitor

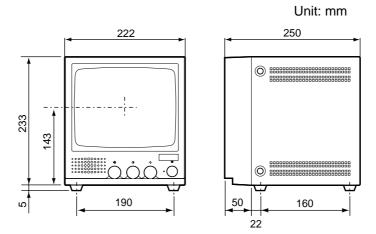

ltem	Specification				
Supply voltage	85 to 264 VAC, 50/60 Hz				
Current consumption	20 W max.				
Vibration resistance	5 to 100 Hz; 0.16-mm full-amplitude or acceleration of 7.35 m/s ² (whichever is smaller), 6 times for 10 minutes each in 3 directions				
Ambient temperature	Operating: -10 to 50 °C (with no condensation) Storage: -20 to 65 °C (with no condensation)				
Ambient humidity	10% to 90% (with no condensation)				
Ambient environment	No corrosive gases				
Materials	Front: ABS plastic Metal part: SECC (galvanized steel sheet)				
CRT size	9 inch (164 $ imes$ 123 mm (H $ imes$ V))				
CRT type	Monochrome CRT				
Resolution	800 TV lines min. (at center)				
System	Number of scanning lines: 600				
	Horizontal frequency: 15.75 kHz				
	Field frequency: 60 Hz				
I/O impedance	75 Ω, high impedance (selectable)				
I/O level and polarity	Composite image signal: 1 V (peak to peak)				
	Image: 0.7 V (peak to peak), positive				
	Synchronization: 0.3 V (peak to peak), negative				
Input signal	NTSC composite video (1.0 V/75 Ω termination)				
Weight	Approx. 4.5 kg				


Memory Cards

F160-N64S and QM300-N128S

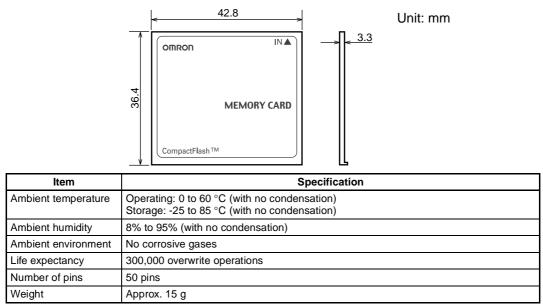

5-5 F200/F300 Camera Parameters

Detailed parameter settings are required when a Camera other than an F150-S1A or F160-S1 is connected. Make the following settings when using an F200/F300 Camera. The *Camera settings* window is displayed at startup and can be displayed at other times by selecting *Camera settings* from the System Menu.

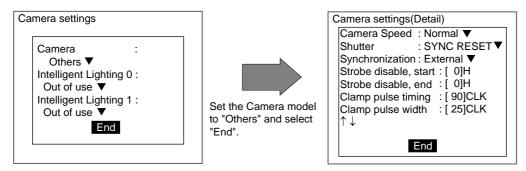

Cam- era	Cam- era speed	Shutter	Syn- chroni- zation		obe able	Shutter speed ¹	Clamp	pulse		itter r pulse	Exter- nal	Image read Y timing
	opoon			Start	End		Tim- ing	Width	Width	Polar- ity	VD Sync ³	3
F200- S	Stan- dard	OFF	Inter- nal	10	17	(None)	60	20	(Note 2)	Posi- tive	OFF	
F300- S	Stan- dard	OFF	Exter- nal	6	8	(None)	90	25	(Note 2)	Posi- tive	OFF	
F300-	Stan-	SYNC	Exter-	-8	-6	1/1,000	90	25	3	Nega-	OFF	
S2R	dard	NON	nal	-2	0	1/2,000				tive		
		RESET		-2	0	1/4,000						
				-2	0	1/10,000						

Connecting a Strobe Device Section 5-6 Syn-chroni-zation Cam-Cam-Shutter Strobe Shutter Clamp pulse Shutter Exter Image read Y era speed disable trigger pulse nal era speed¹ timing VD Start Width Width Polar-End Tim-3 Sync³ ing ity F300-Stan-SYNC Exter--10 -8 1/1,000 90 25 3 Nega-OFF ---S3DR dard nal tive NON -2 1/2,000 0 RESET 3 5 1/4,000 1/10,000 5 7 F300-SYNC -16 -14 1/1,000 OFF Stan-Exter-90 25 3 Nega----S4R dard tive nal NON -11 -9 1/1,500 RESET -8 -6 1/2,000 -6 -4 1/3,000 -5 -3 1/4,000 -3 -1 1/6,000 -3 -1 1/8,000 -2 1/10,000 0 -2 0 1/30,000 -2 0 1/50,000

Note 1. The shutter speed is set in the Camera itself, so the shutter speed setting displayed in the F160 Menu is ignored.

- 2. Set the shutter trigger pulse width to match the strobe's specifications only when a strobe is being used.
- 3. These settings (indicated by ---) are ignored.

5-6 Connecting a Strobe Device

Use the I/O connector's STGOUT0 signal (strobe trigger output) to control the strobe flash timing.

SeeAlso Refer to page 31 for details.

Check the strobe device's specifications and set the appropriate "Shutter trigger polarity" and "Shutter trigger width" in the *Camera settings (Detail)* Menu. The *Camera settings (Detail)* window is displayed at startup and can be displayed at other times by selecting *Camera settings* from the System Menu.

Connecting a Strobe Device

CHECK

The STGOUT0 signal will not be output if a Camera is connected only to camera connector 1. When using only one Camera, always connect it to camera connector 0.

Strobe specifications	Shutter trigger polarity	Shutter trigger width		
STGOUT0 signal when the flash is synchro- nized to the OFF-to-ON transition of the	Positive	The "shutter trigger width" setting deter- mines the pulse width W.		
strobe trigger signal. ₩		When using a Double-speed Camera: W = Shutter trigger width setting (H) \times 32 µs (1H = 32 µs)		
STGOUTO ON OFF		When using a Camera other than a Double- speed Camera: W = Shutter trigger width setting (H) \times 63 µs		
STGOUT0 signal when the flash is synchro-	Negative	(1H = 63 μs)		
nized to the ON-to-OFF transition of the strobe trigger signal.		Note: Depending upon the timing, W may have an error of up to ± 1 H.		

Combining an OMRON Camera and Strobe

The following table shows the timing polarity. Use a strobe that is compatible with this timing.

Camera	Shutter trigger polarity	Shutter trigger width
F150-S1A	Positive	3H (1H = 63 μs)
F160-S1	Positive	3H (1H = 32 μs)
F200-S	Positive	Can be set to match the
F300-S		strobe's specifications.
F300-S2R	Negative	3H (1H = 63 μs)
F300-S3DR		
F300-S4R		

Note The window used to change the shutter trigger polarity and shutter trigger pulse will not be displayed when an F150-S1A or F160-S1 Camera is connected, but the STGOUT0 signal will be output with the polarity and width shown in the table above.

Index

A

ambient temperature, 3

В

battery replacing, 43

С

cables, 3 Camera Cable specifications, 56 Camera characteristics, 52 Camera Only, 17 Camera parameters, 63 camera specifications, 52 Camera with Intelligent Lighting, 17 Camera with Light, 17 Cameras, 3 connecting, 16 overview, 16 CCTV lenses, 22 communications wiring, 36 communications connector, 36 components, 3, 10 computers using Memory Cards, 28 connector, 36 Consoles connecting, 16 specifications and dimensions, 54 crimp terminals, 18

D

dimensions, 45 DIN Track, 11

Ε

Extension Tubes, 24 external devices connecting, 29

F

F150 Cameras dimensions, 46 F150-KP. 54 F150-M05L, 61 F150-M09, 62 F150-S1A, 49 F150-SL20A/SL50A, 42, 46 F150-SLC20, 47 F150-SLC20/SLC50, 42 F150-SLC50, 48 F150-VS, 57 F160 Cameras dimensions, 50 F160-C10E/C15E, 45 F160-KP, 55 F160-N64S, 63 F160-S1, 51 F160-SLC20, 50 F160-SLC20/SLC50, 42 F160-SLC50, 51 F160-VP, 60 F160-VSR3, 58 F160-VSR4, 59 field of vision, 53 fluorescent lighting, 26

G

ground, 18

I/O specifications, 33 I/O terminals, 30 inspections, 44 installation site, 2

L

LCD Monitor, 61 lens characteristics, 52 lens diameters, 23 lenses, 22 light replacing, 41 light characteristics, 53 lighting, 24

Μ

maintenance, 41 manuals, ix Memory Cards, 27 removing, 4 specifications, 63 Monitor connecting, 16 specifications, 61 mounting, 11 bottom surface, 15 rear surface, 12 side surface, 14 mounting distance, 53

Ν

noise resistance, 3

0

optical chart, 22 orientation, 2

Ρ

package contents confirming, 5 Parallel I/O Cable, 31 parallel interface connecting external devices, 30 part names, 10 peripheral devices connecting, 15 power supply, 18 turning OFF, 4 wiring, 19 precautions, xi applications, xiii battery, xii general safety, xii installation, 2 installation environment, xii power supply and wiring, xii products availability, 6

Index

Q

QM300-N128S, 63

R

RESET signal precaution, 4 RS-232C, 36 RS-422, 36

S

serial interface connecting external devices, 34 signal lines, 4 specifications, 45 I/O, 33 strobe connecting, 64 system configuration, 8

Т

terminals, 30 troubleshooting, 40 cables, 41 connection errors, 40 menus, 40 parallel interface, 40 serial interface, 41

V

Video Monitor, 4, 62

W

wiring communications, 36

Revision History

A manual revision code appears as a suffix to the catalog number on the front cover of the manual.



The following table outlines the changes made to the manual during each revision. Page numbers refer to the previous version.

Revision code	Date	Revised content	
1	February 2001	Original production	

OMRON ELECTRONICS LLC

1 Commerce Drive Schaumburg, IL 60173 USA 800.55.OMRON (66766)

OMRON CANADA, INC.

885 Milner Avenue Scarborough, Ontario M1B 5V8 416.286.6465

OMRON ON-LINE

Global - http://www.omron.com USA - http://www.omron.com/oei Canada - http://www.omron.com/oci

24 HOUR FAX ON DEMAND

USA - 847.843.1963 Canada - 788.599.4264

For Distributor Locations or Product Information, Call:				
800.55.OM	RON or 847	7.843.7900		
UNITED STATES	S REGIONAL SAL	ES OFFICES		
Northeast	Boston, MA	508.303.8880		
East	Philadelphia, PA	610.524.1897		
Southeast	Atlanta, GA	770.798.6780		
Central	Cincinnati, OH	513.469.6766		
Midwest	Chicago, IL	847.843.7910		
Southwest	Dallas,TX	972.871.2166		
West	Los Angeles, CA	714.621.3455		
CANADA REGIONAL SALES OFFICES				
Ontario	Toronto	416.286.6465		
	Kitchener	519.896.1144		
	Kingston	613.376.3968		
Quebec	Montreal	514.636.6676 418.864.7378		
British Columbia	Ste-Foy Vancouver	604.522.8855		
Alberta	Edmonton Calgary	403.440.0818 403.257.3095		
	8 1	405.257.5075		
BRAZIL SALES				
Sao Paulo	55.11.5564.6488			
ARGENTINA SA	LES OFFICE			
D 41				
Buenos Aires	54.114.787.1129			
	54. 4.787. 29 N AMERICA SAL	ES OFFICE		